

Check brake pads and the caliper from tilt system

Model: Rapid 3 XL (RP3)

Reason:

Some vehicles may install incorrect brake pads or caliper on tilt system, and it may result in the tilt system being unable to properly lock the vehicle front-end. Please check the mark on the brake pads and the caliper before delivery to the customer.


Preparation:

N/A


Step:

1. Check the caliper from rear-right perspective of the seat apron.

Correct caliper: The blue part should be flat without any pipe hole. Then, jump to Step.2

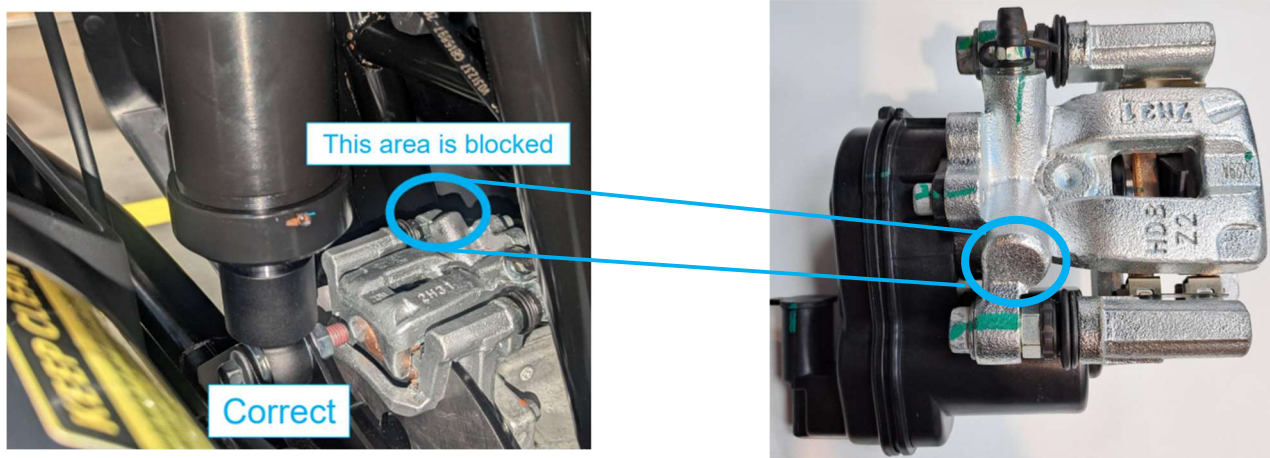

Incorrect caliper: If the vehicle is incorrectly equipped with the wrong caliper, please replace the caliper. (Refer to service manual **15001 Replace the Tilt Brake Caliper**)

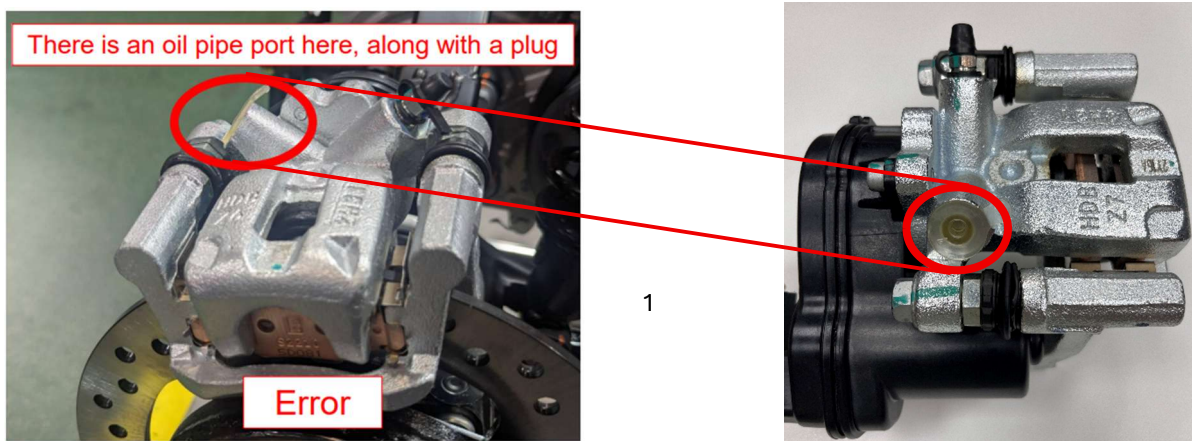

2. Check the production number on brake pads.

Correct production number: S6601


Example:



Incorrect production number: S2210 or other production number.

Please replace a pair of brake pads.(Refer to service manual
15002 Tilt Brake Pads)

Example:

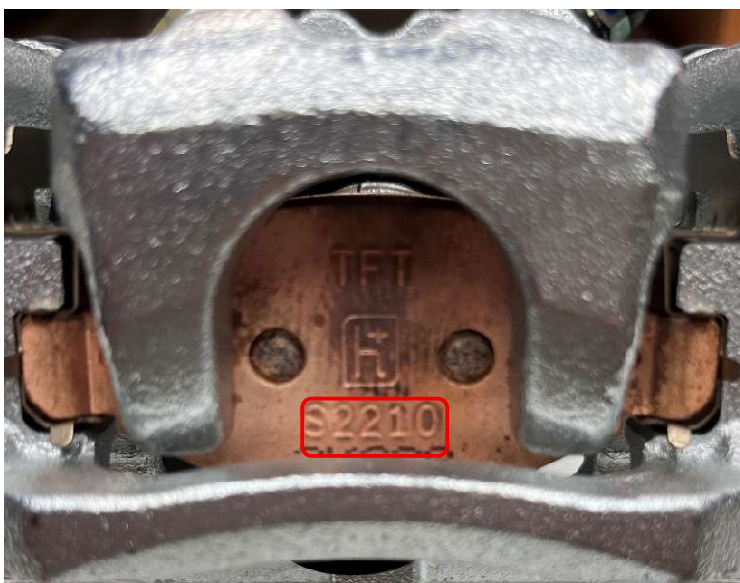

Labor hour & Parts:

Parts		
P/N	Description	QTY.
Tilt Brake Caliper		
RP3-G104001	Tilt Brake Caliper	1
9102007-10	M10-1.25×30	2
Tilt Brake Pads		
Provided by Gaius	Tilt Brake Pads	1 pair
Labor Hour		
Description		HR
15001 Tilt Brake Caliper		0.3
15002 Tilt Brake Pads		0.3